

83 ASHLEY WAY LEESPORT, PA 19533 (610) 926-2146 Remit To:
PO BOX 765
LEESPORT, PA 19533
accounting@bermantruckgroup.com

INVOICE

R001058651:01

www.bermantruckgroup.com

P.O. Number

#### INVOICE

V.I.N 3AKJGLDV4ESFR0779

 Year
 14

 Make
 FTL

 Model
 CA125SLP

Job#1 \*01

Cause

Condition

CEL IS ON FOR NOX CONVERSION EFFICIENCY. REPLACE 1-BOX.

Claim Number

Correction

TRUCK BATTERIES COMPLETELY DEAD. CHARGE BATTRIES, GOT TRUCK IN SHOP. R&I STEPS, STEP BOLTS SEIZED AND HAD TO BE CUT OFF. R&I DPF'S R&R ONE BOX. R&I SENSORS. MULTIPLE SENSOR AND PRESSURE TUBES SEIZED, R&R PRESSURE TUBES, R&R DPF TEMP SENSOR, R&R SCR OUTLET TEMP SENSOR. HEAT SHIELD BOLTS SEIZED HAD TO CUT ALL HEAT SHIELD BOLTS OFF. R&R BOLTS AND NUT SERTS. CLEAR CODES AND FOUND THE TRUCK HAVE OUT TEST ACM ON. LOCATE TRUCK'S ACM. R&I LEFT FRONT FENDER. INSTALL THE CORRECT ACM AND ACM COVER. CLEAR CODES. PROGRAM NEW ONE BOX #. CLEAR CODES, PERFORM PARKED REGEN AND SCR TEST.

TRUCK BATTERIES COMPLETELY DEAD. CHARGE BATTRIES, GOT TRUCK IN SHOP. R&I STEPS, STEP BOLTS SEIZED AND HAD TO BE CUT OFF. R&I DPF'S R&R ONE BOX. R&I SENSORS. MULTIPLE SENSOR AND PRESSURE TUBES SEIZED, R&R PRESSURE TUBES, R&R DPF TEMP SENSOR, R&R SCR OUTLET TEMP SENSOR. HEAT SHIELD BOLTS SEIZED HAD TO CUT ALL HEAT SHIELD BOLTS OFF. R&R BOLTS AND NUT SERTS. CLEAR CODES AND FOUND THE TRUCK HAVE OUT TEST ACM ON. LOCATE TRUCK'S ACM. R&I LEFT FRONT FENDER. INSTALL THE CORRECT ACM AND ACM COVER. CLEAR CODES. PROGRAM NEW ONE BOX #. CLEAR CODES, PERFORM PARKED REGEN AND SCR TEST.

I BOX SERIAL NUMBER: 12400026964149

	1 BOX SERIAL NUMBER					
Qty	Item	Description	end of the end of the extension	and the same of th	Price	Extended
9.0		LABOR TO PERFORM R	EPAIRS			1,215.00
10	001V/DDE N910143006001	SCREW M6X16			0.58	5.80
10	001V/DDE A0049941645	U NUT,SST,SPRING,M6	;		1.22	12.20
3	001V/DDE A0019909403	SCREW,HEXALOBUL,M	16 X 20MM		2.69	8.07
2	001V/DDE A0004902241	EXH CLAMP			129.21	258.42
2	001V/DDE A6809950202	CLAMP			55.16	110.32
1	001V/DDE A0001421180	GASKET,DEF DOSER N	METAL SEAL		16,82	16.82
1	001V/DDE EA6804905556	DOC&CLAMPKIT			7,866.48	7,866.48
1	001V/DDE EA6804905556-	CORE DOC&CLAMPKIT			500.00	500.00
1	001V/DDE A6804912537	LINE, DPF PRESSURE (	DUT		37.82	37.82
1	001V/DDE A6804912437	PRESSUR LINE			39.68	39.68
1	001V/DDE A6805401517	TEMP SENSOR			71.24	71.24
1	001V/DDE A6805401917	TEMP SENSOR			53.02	53.02
1	001X/HMP051	HOWES RUST PENETR	ENT		6.41	6.41
-1	001V/DDE EA6804905556-	CORE DOC&CLAMPKIT			500.00	-500,00
	Labor Subtotal 1,21	5.00 Parts Subtotal	8,486.28	Operation Subtotal	9,701,28	



83 ASHLEY WAY LEESPORT, PA 19533 (610) 926-2146 Remit To:
PO BOX 765
LEESPORT, PA 19533
accounting@bermantruckgroup.com

INVOICE

R001058651:01

www.bermantruckgroup.com

P.O. Number

## INVOICE

V.I.N 3AKJGLDV4ESFR0779

 Year
 14

 Make
 FTL

 Model
 CA125SLP

Job#2 \*AI

Condition

Claim Number

ANNUAL INSIDE INSPECTION, OLD MILES 560826, STICKER EXPIRED 05/22.PRIME INS.CO.POL#SC22031097, EXP:3/10/23

Cause

Correction

RIGHT FRONT TURN SIGNAL BULB AND SOCKET BURNT OUT, R&R BOTH BULB AND SOCKET. BOTH SIDES STEER AXLE BRAKE SHOE CRACKED AND LIFTING OFF THE METAL PORTION ON THE BRAKE SHOE. PUT P&A IN FOR SHOES AND DRUMS.

STICKER#AI2 00793289,EXP:6/23. LOWEST TIRE:13/32.FRONT BRAKES:NEW:15/32R,REAR:13/32R,

Qty		Description		Price	Extended
1.4		LABOR TO PERFORM REPAIRS			154.00
1	ASTKR	ANNUAL INSPECTION STICKER		9.00	9.00
1	001V/HAL 224 394 045	HOLDER, METALLIZED BULB		5.89	5.89
0	С	CC-650-160		0.00	0.00
1	001V/PLC 4157NALLB2 TEMP	LONG LIFE MINIATURE BULB BLIST		6.15	6.15
	Labor Subtotal 154.00	Parts Subtotal 21.04	Operation Subtotal	175.04	

Job#4 \*99 Condition Claim Number

REPLACE STEER AXLE BRAKES & DRUMS. \*\*REPAIR.\*\*

Cause

Correction

R&R STEER AXLE DRUMS AND BRAKE SHOES. ANCHOR PINS ON BOTH SIDE SEIZED. HEAT AND PRESS PINS OUT WITH ANCHOR PIN TOOL.

REPLACE STEER AXLE BRAKE SHOES AND DRUMS, SHOES ARE CRACKED AND SEPERATING.

Qt	y Item	Description		18 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	Price	Extended
2.4	1	LABOR TO PI	ERFORM REPAIRS			348.00
2	001V/CM 10014756	DRUM - 16.5	5X5 BALANCED		226,21	452.42
2	001V/TDA XK120147	720QP REMAN SHO	DE KIT		84.34	168.68
2	001V/TDA XK120147	720QP-CORE REMAN SHO	DE KIT		36.00	72.00
-2	001V/TDA XK120147	720QP-CORE REMAN SHO	DE KIT		36.00	-72.00
	Labor Subtotal	348.00 Part	ts Subtotal 621.	.10 Operation Subtota	969.10	



83 ASHLEY WAY LEESPORT, PA 19533 (610) 926-2146 Remit To:
PO BOX 765
LEESPORT, PA 19533
accounting@bermantruckgroup.com

R001058651:01

INVOICE

www.bermantruckgroup.com

P.O. Number

## INVOICE

V.I.N 3AKJGLDV4ESFR0779

Year

14 FTL

Make Model

CA125SLP

DISCLAIMER OF WARRANTIES

ANY WARRANTIES ON THE PRODUCTS SOLD HEREBY ARE THOSE MADE BY THE MANUFACTURER, IF ANY. THE SELLER HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES EITHER EXPRESS OR IMPLIED, INCLUDING ANY IMPLIED WARRANTY OR MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE, AND BERMAN FREIGHTLINER NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF SAID PRODUCTS. WE HEREBY CERTIFY THAT THESE GOODS WERE PRODUCED IN COMLIANCE WITH ALL APPLICABLE REQUIREMENTS OF SECTIONS 6,7 AND 12 OF THE FAIR LABOR STANDARDS ACT OF 1938, AS AMENDED AND O FREGULATIONS AND ORDERS OF THE ADMINISTRATOR OR WAGE AND HOUR DIVISION ISSUED UNDER SECTION 14 THEREOF,

RECEIVED BY: X

 Misc. Charges\*\*
 9.00

 Parts:
 9,119.42

 Labor:
 1,717.00

 Sublet:
 0.00

 Misc Supplies\*
 103.02

 Prepay:
 0.00

 Taxes:
 656.91

Total:

11,605.35

Page 3 of 3

## Wensel's Service Centers

1625 North 5th Street
Reading, PA 19601
Phone: 610-375-8411 Fax: 610-375-7136
Customer Satisfaction in All We Do

Invoice # 17001

DW01

Estimate #: 17383

#### 2014 Freightliner Cascadia - 125 white

License:

VIN: 3AKJGLDV4ESFR0779

# **Description Of Services**


#### Replace DPFs and all related gaskets and clamps.

Removed upper step and outter heat sheild. Disconnected heat sensor wiring due to it being seized into one box. Removed heat shield and removed clamps retaining DPFs. Removed DPFs one at a time noting locations of clamp positioning. Cleaned mating surfaces and installed new DPFs with new gaskets and clamps. Reassembled remaining components in reverse order, replacing upper step mounting bolts and washers. Connected scan tool and reset DPF ash load by inserting new DPF serial numbers. Cleared codes and put truck out in regen to confirm repair. After regen was finished performed road test and recheck for codes. No codes at this time.

Labor: \$607.50	Parts: \$1,800.39	Sublet:\$0.00		Job Total: \$2,407.89	
Cutting / Sanding	Cutoff, grinding, Sanding supplies	•	1.00	\$21.43	\$21.43
nut-sm	Nut grade8 small		2,00	\$0.45	\$0.90
washer-sm	washer small grade8		4.00	\$0.42	\$1.68
bolt-sm	Small grade 8 bolt		2.00	\$1.08	\$2.16
77124	Nickel Anti Seize Lubricant		0.20	\$46.30	\$9.26
ty1550bk	Zip Tie		2.00	\$0.75	\$1.50
DDEA6809950202	V-band clamp		2.00	\$64.08	\$128.16
DDERA0014903492	DPF-HAS CORE		2.00	\$817.65	\$1,635.30
Part Number	Description		<u>Quantity</u>	<u>Sale</u>	Extended

 Labor: \$33.75
 Parts: \$0.00
 Sublet: \$0.00
 Job Total: \$33.75



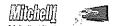

#### Wensel's Service Centers

1625 North 5th Street Reading, PA 19601 Phone: 610-375-8411 Fax: 610-375-7136 Customer Satisfaction in All We Do

Invoice # 17001

DW01

Estimate #: 17383

2014 Freightliner Cascadia - 125 white

License:

VIN: 3AKJGLDV4ESFR0779

Unit #:

## **Description Of Services**

Continued From Previous Page

Service Advisor: Yost, Stephanie

I consent to receiving text messages regarding your services, via automated technology, to the cell phone number you have on file. I acknowledge that I do not have to provide this consent to receive your services. Message and data rates may apply. Respond STOP to any message to cancel.

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

\$641.25 Labor Total: \$1,800.39 Parts Total: \$9.62 Shop Sup.: \$0.00 HazMat: Sub Total: \$2,451.26 Tax Total: \$147.08 Grand Total: \$2,598.34 **Balance Due:** \$2,598.34







